

上関大橋 P2橋脚 損傷状況写真



写真-10



写真-11



写真-12



写真-13



写真-14



写真-15



写真-16



写真-17



写真-18



写真-19



写真-20



写真-21



写真-22



写真-23



写真-24



写真-25

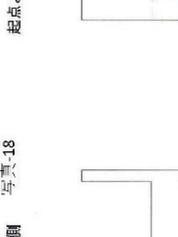


写真-26



写真-27

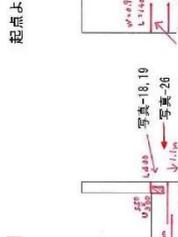


写真-28



写真-29



写真-30



写真-31

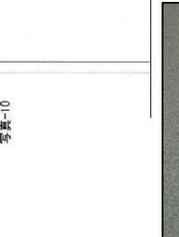


写真-32

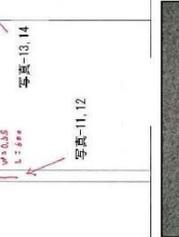


写真-33



写真-34

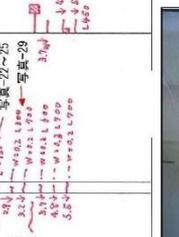


写真-35



写真-36



写真-37

終点側

起点より右側

起点側

終点側

起点より左側

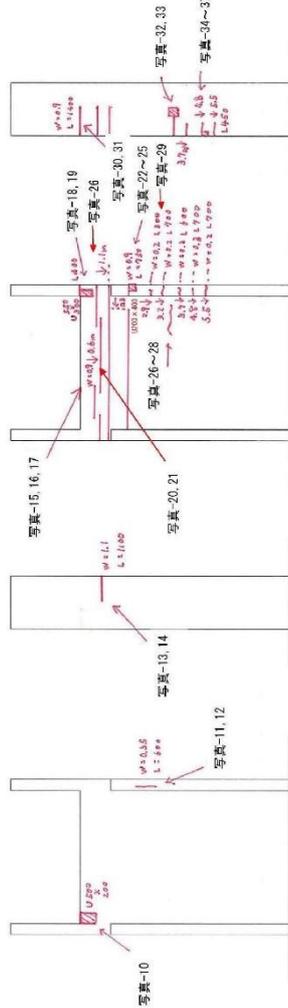


写真-38



写真-39



写真-40



写真-41



写真-42



写真-43



写真-44



写真-45



写真-46

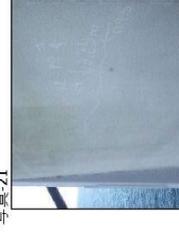


写真-47



写真-48

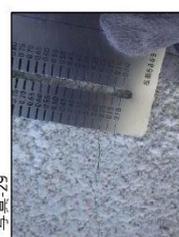


写真-49



写真-50

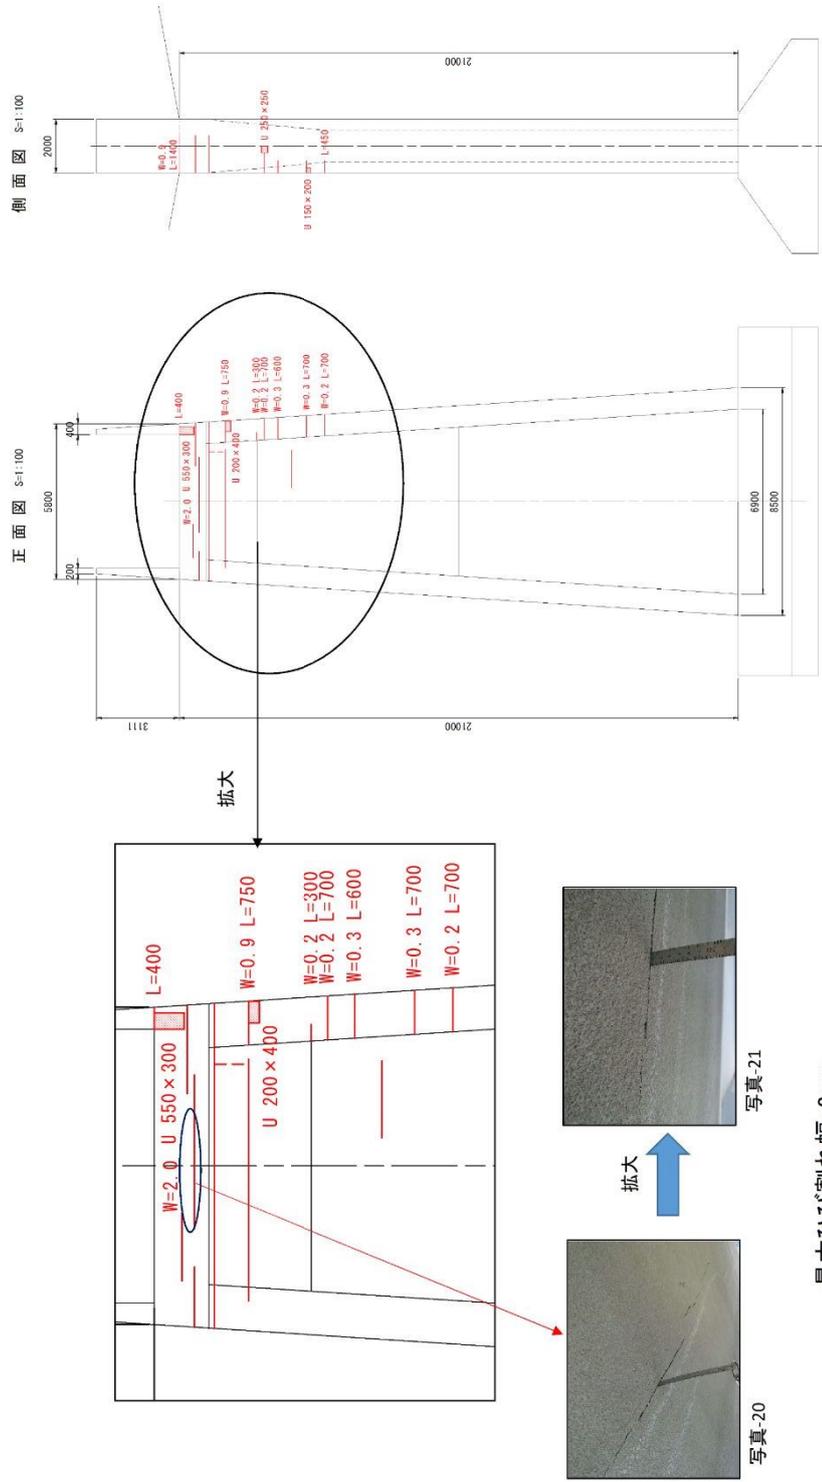



写真-51

写真-26~28

写真-34~37

上関大橋 P2橋脚 損傷状況写真(拡大)



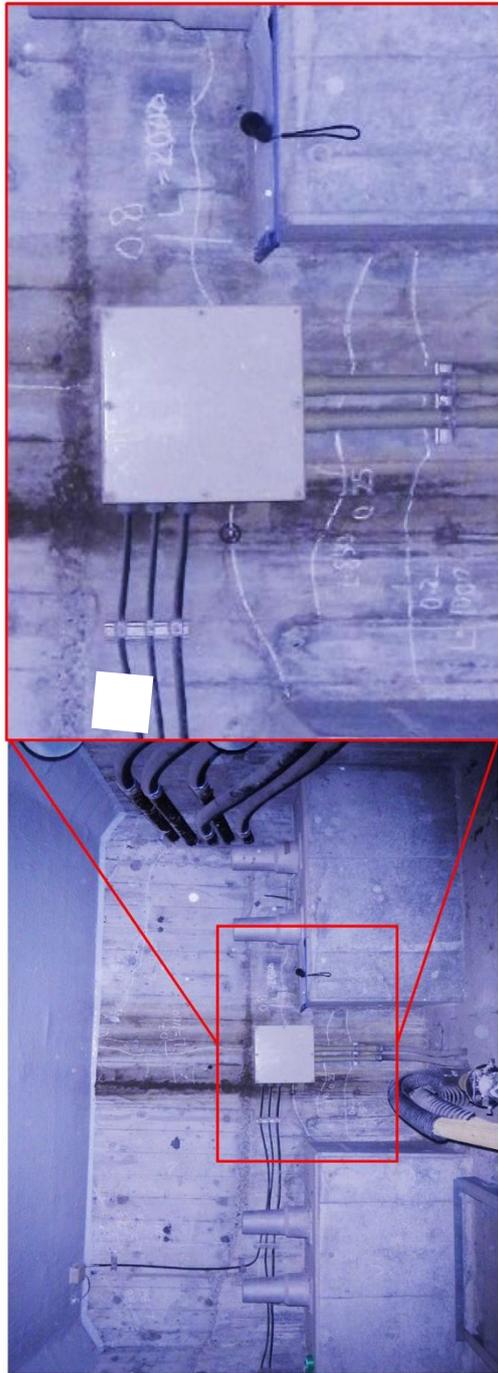


A1橋台
(正面図)

定着部付近に幅1.1mmのひびわれ


ひびわれ [w=0.2mm L=1.1m]



ひびわれ
[w=0.8mm L=0.8m] [w=0.4mm L=0.6m]
[w=0.1mm L=0.4m] [w=0.4mm L=1.0m]

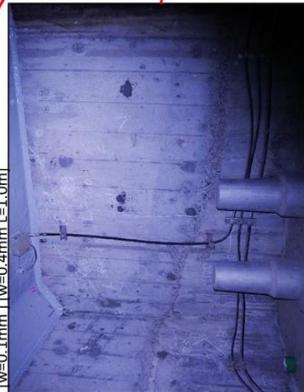

ひびわれ
[w=1.1mm L=0.5m] [w=0.25mm L=0.85m]
[w=0.2mm L=1.0m]

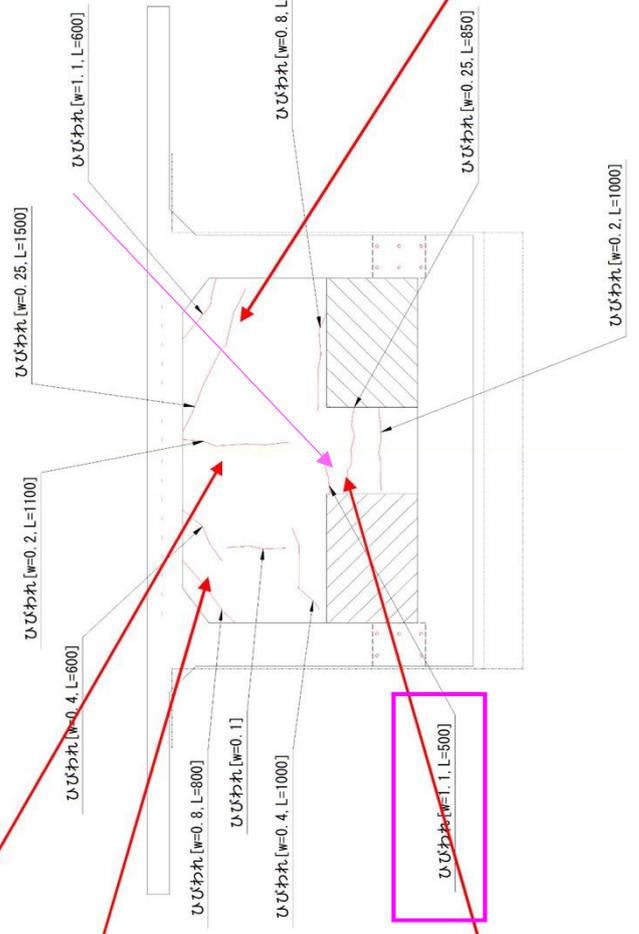

ひびわれ
[w=1.1mm L=0.6m] [w=0.25mm L=1.5m]
[w=0.8mm L=1.2m]



【主要位置のすき間（中央ヒンジ部）】

測定位置	測定日	11/17(火)			11/18(水)		
		測定時刻	9:00	15:10	差	12:30	11/17との差
	①	156	152	-4	152	0	
	②	230	220	-10	218	-2	
	③	260	258	-2	256	-2	
	④	57	57	0	57	0	
	⑤	52	52	0	52	0	
	⑥	145	143	-2	143	0	
	⑦	150	150	0	150	0	
	⑧	152	152	0	151	-1	
	⑨	48	47	-1	47	0	
	⑩	50	49	-1	49	0	
	⑪	273	272	-1	271	-1	
	⑫	235	235	0	235	0	
	⑬	143	139	-4	138	-1	
	⑭	105	100	-5	101	+1	
	⑮	11	10	-1	10	0	
	⑯	102	100	-2	100	0	
	⑰	110	108	-2	107	-1	
	⑱	118	117	-1	117	0	
	⑲	0	0	0	0	0	
	⑳	103	98	-5	97	-1	
	㉑	105	102	-3	102	0	
	㉒	12	12	0	12	0	
	㉓	93	91	-2	91	0	
	㉔	105	101	-4	101	0	
	㉕	115	112	-3	112	0	
	㉖	0	0	0	0	0	
	㉗	102	104	+2	103	-1	

単位(mm)

【主要位置のすき間（中央ヒンジ部防護柵・A2橋台橋座）】

測定位置	測定日	11/17(火)			11/18(水)			
		10:45	16:05	差	8:30	11/17との差	15:00	11/17との差
 <p>第2径間 防護柵 ～ 第3径間 防護柵</p> <p>第2径間 地覆 ～ 第3径間 地覆</p> <p>第2径間 歩道 ～ 第3径間 歩道</p>	測定時刻	180	177	-3	178	+1	175	-2
	①	180	177	-3	179	+2	176	-1
	②	182	178	-4	180	+2	177	-1
	③	181	177	-4	179	+2	176	-1
	④	97	92	-5	94	+2	92	0
	⑤	107	102	-5	104	+2	103	+1
	⑥	102	97	-5	99	+2	98	+1
	⑦	140	135	-5	136	+1	136	+1
	⑧	177	173	-4	174	+1	174	+1
	⑨	172	167	-5	169	+2	169	+2
	⑩	170	168	-2	169	+1	169	+1
	⑪	176	171	-5	172	+1	171	0
	⑫	117	113	-4	115	+2	111	-2
	⑬	110	106	-4	109	+3	105	-1
	⑭	103	98	-5	101	+3	97	-1
	⑮	105	99	-6	102	+3	98	-1
⑯								
A2橋台	測定時刻	11:30	16:20	差	8:20	11/17との差	11:30	11/17との差
	①	265	265	0	263	-2	260	-5
	②	255	255	0	254	-1	253	-2
	③	265	265	0	263	-2	261	-4
	④	265	265	0	265	0	264	-1
	⑤	253	253	0	249	-4	250	-3

単位(mm)